

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

### **CHILD SEATS:**

Evenflo is recalling certain Maestro child restraint systems with model numbers beginning with 310 and built from November 24, 2009, through April 9, 2010. These seats fail to conform to the structural integrity requirements of Federal Motor Vehicle Safety Standard No. 213, "Child Restraint Systems." In the event of a crash, a crack may form at the front of the seat adjacent to the harness adjuster causing the child not to be adequately restrained, increasing the risk of injury. Evenflo will provide owners and caregivers a reinforcement plate along with repair instructions free of charge. The safety recall began on October 15, 2010. Owners may contact Evenflo toll-free at 1-800-233-5921.

**10C-005**

Britax is recalling certain Britax Chaperon infant car seats model E9L69N9 Moonstone, E9L69P2 Red Mill, E9L69P3 Savannah, and E9L69P5 Cowmooflage, manufactured from April 2009 through May 2010. The chest clip was incorrectly produced which could result in a more brittle chest clip than was intended. As a result, the chest clip which positions the harness straps across the infant's shoulders may break when the chest clip is engaged as the infant is secured into the infant car seat. The sharp edges of the broken chest clip could create a risk of a skin laceration and the fractured components of the chest clip may present a small parts/choking hazard. Britax will mail to consumers notice and remedy kits that contain a replacement chest clip and instruction sheet. The safety campaign is expected to begin on or about November 11, 2010. Owners may contact Britax Customer Service Department at 1-888-427-4829.

**10C-006**

### **EQUIPMENT:**

Dexter Axle is recalling certain trailer axle assemblies manufactured from August 15, 2010, through August 30, 2010. On some axles, cracks could appear in the spindle weld. These cracks can propagate and cause the spindle to detach from the axle tube, resulting in the separation of the wheel end from the vehicle, creating a road hazard that increases the risk of a crash to other vehicles, and compromises the driver's control of the vehicle. Dexter Axle is working with vehicle manufacturers to identify those owners who may have the affected axles installed on their vehicle. Dexter Axle will notify owners of any affected replacement equipment axles. The affected axle assemblies will be replaced free of charge. Owners may contact Dexter Axle at 1-800-400-2164 or their vehicle manufacturer.

**10E-048**

Norcold is recalling certain gas absorption refrigerators which are sold for application in recreational vehicles. Norcold has recalled models 1200AC, 1200ACIM, 1200LR, 1200LR, 1200LRIM, and 1201LRIM under previously issued recalls identified as 02E-045, 08E-030, 09E-026, and 09E-027. These recalls covered cooling units installed on the 1200 series product manufactured from December 1996 through December 2002. Recalls 08E-030, 09E-026, and 09E-027 involved the installation of a thermal switch on the cooling units manufactured from December 1996 through December 2002. With the action taken with this recall campaign, Norcold is extending a recall of all 1200, 1201, 1210, and 1211 models to include units produced from January 1, 2003, to October 6, 2010, with cooling unit models to include cooling unit serial numbers from 700000 to 13085759, non consecutively. The population of refrigerators being addressed contains either a sensing algorithm or a thermal switch to shut

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. Norcold has now decided the response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. An insufficient response time can result in power not being shut-off in sufficient time to prevent a fire. Norcold will notify recreational vehicle manufacturers, distributors, dealers, service centers, and vehicle owners of the hazard and offer a free remedy to prevent temperature elevation that could allow a fire. The remedy is to affix a thermocouple, with a faster response time, to all refrigerators with a sensing algorithm or a thermal switch. The safety recall is expected to begin during November 2010. Owners may contact Norcold at 1-800-767-9101 or their vehicle manufacturer. This recall supersedes recall campaigns 02E-045, 08E-030, 09E-026, and 09E-027.

**10E-049**

ADVICS is recalling certain brake master cylinders installed as original equipment in certain Toyota and Honda passenger vehicles. Brake fluid containing polymers is used that acts as a lubricant for certain brake system components. If replacement brake fluid is used that does not contain such polymers, or that contains only small amounts, a part of the rubber seal located at the rear of the brake master cylinder may become dry, and the seal may curl during movement of the piston. If this occurs, a small amount of brake fluid could slowly leak from the seal into the brake booster. A leak of brake fluid could lead to a change in brake pedal feel and, over time, a degradation in braking performance increasing the risk of a crash. Owners of the defective brake master cylinders will be notified by their vehicle manufacturer. The safety recall is expected to begin during November 2010. Owners may contact Toyota at 1-800-331-4331 and Lexus at 1-800-255-3987 and Honda owners may contact Honda at 1-800-999-1009. See Toyota recall campaign No. 10V-499 and Honda recall campaign No. 10V-504.

**10E-051**

Tredit Tire & Wheel is recalling certain 15" painted wheels, models Spoke or Mod, installed as original equipment on recreational vehicles. Some of the wheels, which fasten to the axle of the vehicle body and serve as a mounting point for tires, could contain mis-aligned welds. The wheels may break while in use, increasing the risk of a crash. Tredit Tire & Wheel is working with the vehicle manufactures to identify owners who may have had the defective wheels installed as original equipment. The affected wheels will be replaced free of charge. Owners may contact their vehicle manufacturer or Trans Texas Tire at 1-800-289-8667.

**10E-052**

**TIRES:**

None during October 2010.

**VEHICLES:**

BMW is recalling certain model year 2004-2010 5-Series, 6-Series, and model year 2002-2008 7-Series vehicles. A check valve of the brake vacuum pump may leak a small amount of lubricating oil. Over time this could result in contamination of the brake booster. Power assist braking performance could be

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

adversely affected. In extreme cases there could be a complete loss of power assist braking. An unexpected reduction or loss in power braking assist may increase the risk of a crash. The manufacturer has not yet provided a remedy or an owner notification schedule for this campaign. Owners may contact BMW at 1-800-525-7417.

**10V-446**

Rolls-Royce is recalling certain model year 2003-2010 Phantom, model year 2007-2010 Phantom Drophead coupe, and model year 2008-2010 Phantom coupe vehicles. A check valve of the brake vacuum pump may leak a small amount of lubricating oil. Over time this could result in contamination of the brake booster. Power assist braking performance could be adversely affected. In extreme cases there could be a complete loss of power assist braking. An unexpected reduction or loss in power braking assist may increase the risk of a crash. The manufacturer has not yet provided a remedy or an owner notification schedule for this campaign. Owners may contact BMW at 1-800-525-7417.

**10V-447**

Nu Wa is recalling certain model year 2006 Custom Campers HH II, and model year 2006-2007, Custom Campers LS travel trailers, equipped with Lippert axles components. These vehicles may contain mis-located welds attaching the axle spindle to the axle tube. If the welds are mis-located, the spindle may partially or completely separate from the axle tube and the wheel and hub assembly may come off the vehicle. A separated tire and wheel assembly could strike other vehicles and/or pedestrians, risking injury or death, and/or cause significant damage property. Nu Wa is working with Lippert to inspect and replace if an axle is found to be defective on a vehicle free of charge. The safety recall began September 18, 2010. Owners may contact Lippert Components, Inc.'s Axle Service & Warranty Department at 1-877-870-4900.

**10V-448**

Paccar is recalling certain model year Kenworth and Peterbilt vehicles. A manufacturing defect in the seal supplied by a component manufacturer installed on the output shaft of the exhaust gas recirculation (EGR) valve actuator may cause eventual delamination of the seal. Delamination of the seal may allow engine oil to leak from the EGR valve onto exhaust components. The leaking of engine oil onto hot exhaust components, such as when the engine is under significant load, may create the possibility of a fire. Dealers will replace the EGR valve assembly on the subject vehicles equipped with the Paccar MX engine. This service will be performed free of charge. The safety recall began on October 29, 2010. Owners may contact Kenworth at 1-425-828-5440 and Peterbilt at 1-940-591-4196.

**10V-453**

Forest River is recalling certain recreational vehicles equipped with Dimplex Electraflame, Symphony, or Optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat. An overheated receiver could cause a fire. Forest River is working with Dimplex and Dimplex will provide owners a free replacement plug-in remote control kit. The safety recall is expected to begin during November 2010. Owners may contact Dimplex North America Customer Service at 1-888-346-7539.

**10V-454**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

Hyundai is recalling certain model year 2011 Sonata vehicles manufactured from December 11, 2009, through September 10, 2010. On some of these vehicles the steering column intermediate shaft universal joint connections may have been either improperly assembled or insufficiently tightened. Improper assembly or insufficient tightening of the connections could result in a complete separation or compromised attachment of the connections, such that the driver could experience a loss of, or reduction in, steering capability increasing the risk of a crash. Dealers will inspect the steering column intermediate shaft universal joint connections for proper assembly and torque. In addition dealers will update the power steering software free of charge. The safety recall began on October 11, 2010. Owners may contact Hyundai customer service center at 1-787-999-3333.

**10V-457**

Tesla is recalling certain model year 2010 Roadster 2.0 and 2.5 vehicles equipped with a 12V auxiliary cable. The 12V auxiliary cable for the low voltage back up power system may be improperly routed. If the wire is improperly routed, and trapped against the wheel well cover, the wire may abrade against the edge of the carbon fiber armature and, over time, expose the wire. Contact between the bare wire and carbon fiber may cause a short-circuit leading to possible electrical arcing. Short circuit and electrical arcing could lead to a fire in the right front headlamp area. Tesla motors will check the routing of the 12V auxiliary cable and install a protective sleeve over the wire free of charge. This will prevent misrouting and pinching by the wheel well cover. The safety recall began on October 31, 2010. Owners may contact Tesla customer service at 1-877-888-3752.

**10V-458**

Mercedes Benz is recalling certain model year 2010 C-Class, model 204, E-Class, model 212, and model year 2010-2011 E-Class Coupe/Cabriolet model 207 vehicles. The power steering system in the subject vehicles may fail due to the loss of power steering fluid. Owners may not have sufficient control of the vehicle in areas, such as parking lots, where maximum power steering is required, increasing the risk of a vehicle crash. Dealers will check and retorque the connection fitting free of charge. The safety recall began on October 31, 2010. Owners may contact Mercedes-Benz at 1-800-367-6372.

**10V-459**

Forest River is recalling certain model year 2011 sandpiper and sierra trailers equipped with Dexter Axles. On some axles, cracks could appear in the spindle weld. These cracks can propagate and cause the spindle to detach from the axle tube, resulting in the separation of the wheel end from the vehicle, creating a road hazard and/or compromising the driver's control of the vehicle, increasing the risk of a vehicle crash. Forest River is working with Dexter Axle and will inspect the axle serial number and replace it if it falls within the serial number range. Replacement of the axle will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact Forest River's warranty department at 1-574-534-3167 or Dexter Axle at 1-800-400-2164.

**10V-460**

Heartland is recalling certain model year 2011 fifth wheel trailers equipped with Dexter Axles. On some axles, cracks could appear in the spindle weld. These cracks can propagate and cause the spindle to detach from the axle tube, resulting in the separation of the wheel end from the vehicle, creating a road hazard that increases the risk of a crash to other vehicles, and compromises the driver's control of the

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

vehicle increasing the risk of a vehicle crash. Heartland is working with Dexter Axle and will inspect the axle serial number and replace it if it falls within the serial number range. Replacement of the axle will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact Heartland Warranty Service Department at 1-877-262-8032 or Dexter Axle at 1-800-400-2164.

**10V-461**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Terry Poe Automotive on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Terry Poe Automotive by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-462**

Navistar is recalling certain model year 2011 International 7300, 7400, 7500, vehicles for failing to comply with the requirements of federal motor vehicle safety standard no. 108, "Lamps, Reflective Devices, and Associated Equipment." These vehicles are installed with improper headlight height of 55.5 inches and the correct height should be 54 inches. Improper height on the headlights may not fully illuminate the road surface or may inhibit the ability of motorists to see vehicles which can increase the risk of a crash. Dealers will install the correct headlights free of charge. The safety recall is expected to begin on or before December 1, 2010. Owners may contact Navistar at 1-800-448-7825.

**10V-463**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Stegall Auto Accessories on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Stegall Auto Accessories by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-464**

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

Altec is recalling certain model year 2008-2009 WC126 and WC166, model year 2009-2010 WC126A and WC166A wood chipper utility vehicles built from January 2008 through May 2010. It was discovered cracks may develop in the frame rails of wood chippers due to concentrated loads on the frame rail flange at the axle mount. While loading the frame could brake increasing the risk of property damage and personal injury. Dealers will inspect and repair or replace as necessary free of charge. The safety recall began on October 25, 2010. Owners may contact Altec at 1-877-462-5832.

**10V-465**

Navistar is recalling certain model year 2009-2011 Monaco Monarch and model year 2010-2011 Holiday Rambler Admiral recreational vehicles manufactured from June 4, 2009, through June 26, 2010. The windshield wiper system may become inoperable without warning resulting in reduced driver visibility. Decreased driver visibility may increase the risk of a crash possibly resulting in property damage, personal injury or death. Dealers will inspect and correct if necessary the windshield wiper system free of charge. The safety recall began on October 27, 2010. Owners may contact Navistar at 1-800-448-7825.

**10V-466**

Winnebago is recalling certain model year 2005 through 2009 Winnebago Sightseer and Itasca Sunova motor homes because the dinette area seat belt restraints on those vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 210, "Seat Belt Assembly Anchorages." In a collision, the generated crash forces can cause the restraint's attachment to tear and allow the anchor to separate from the body of the vehicle. If the restraint separates from the vehicle during a crash, the belt will not properly restrain the seat occupant, increasing the risk of injury or death to the occupant. The safety recall is expected to begin during November or early December 2010. Owners may contact Winnebago at 1-800-537-1885.

**10V-467**

Daimler Trucks is recalling certain model year 2008 through 2011 Saf-T-Liner C2 and Saf-T-Liner HDX school buses manufactured from October 5, 2006, through May 24, 2010, equipped with EPA 2007 MBE 900 Detroit Diesel engines. Engine software may not react properly to certain aftermarket treatment device fault codes. The software may unnecessarily shutdown a vehicle or may fail to shutdown a vehicle with an aftermarket device over-temp fault. Unexpected shutdown of a vehicle may increase the risk of a crash. Overheating of the aftertreatment device without engine shutdown may result in a fire. Daimler Trucks will notify owners and repairs will be performed by Detroit Diesel free of charge. The safety recall is expected to begin on or about November 12, 2010. Owners may contact Daimler Trucks at 1-800-547-0712. Daimler Trucks' recall campaign number is 10C-6.

**10V-468**

Jayco is recalling certain model year 2011 Pinnacle fifth wheel trailers equipped with Dexter Axles. On some axles, cracks could appear in the spindle weld. These cracks can propagate and cause the spindle to detach from the axle tube, resulting in the separation of the wheel end from the vehicle, creating a road hazard that increases the risk of a crash to other vehicles, and compromises the driver's control of the vehicle increasing the risk of a vehicle crash. Jayco is working with Dexter Axle and will inspect the axle serial number and replace it if it falls within the serial number range. Replacement of the axle will be performed free of charge. The safety recall began on October 18, 2010. Owners may contact Jayco at 1-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

800-283-8267 and Dexter Axle at 1-800-400-2164.

**10V-469**

Winnebago is recalling certain model year 2006 through 2011 Winnebago View and Itasca Navion motor homes because the dinette area seat belt restraints on those vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 210, "Seat Belt Assembly Anchorages." In a collision, the generated crash forces can cause the restraint's attachment to tear and allow the anchor to separate from the body of the vehicle. If the restraint separates from the vehicle during a crash, the belt will not properly restrain the seat occupant, increasing the risk of injury or death to the occupant. Winnebago will add additional seat belt anchorages free of charge. The safety recall is expected to begin on or before November 12, 2010. Owners may contact Winnebago at 1-800-537-1885.

**10V-470**

Winnebago is recalling certain model year 2008 Winnebago Voyage and, Itasca Sunrise and, model year 2009-2011 Winnebago Adventurer and, Itasca Suncruiser motor homes because the dinette area seat belt restraints on those vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 210, "Seat Belt Assembly Anchorages." In a collision, the generated crash forces can cause the restraint's attachment to tear and allow the anchor to separate from the body of the vehicle. If the restraint separates from the vehicle during a crash, the belt will not properly restrain the seat occupant, increasing the risk of injury or death to the occupant. Winnebago will notify owners and dealers will repair the vehicles free of charge. The safety recall is expected to begin during November or early December 2010. Owners may contact Winnebago at 1-800-537-1885.

**10V-471**

Daimler Trucks is recalling certain model year 2007 through 2010 Freightliner Business Class M2, Custom Chassis MT45, S2 Chassis, and Sterling Acterra vehicles manufactured from October 5, 2006, through May 24, 2010, equipped with EPA 2007 MBE 900 Detroit Diesel engines. Engine software may not react properly to certain aftermarket treatment device fault codes. The software may unnecessarily shutdown a vehicle or may fail to shutdown a vehicle with an aftermarket device over-temp fault. Unexpected shutdown of a vehicle may increase the risk of a crash. Overheating of the aftertreatment device without engine shutdown may result in a fire. Daimler Trucks will notify owners and repairs will be performed by Detroit Diesel free of charge. The safety recall is expected to begin on or about November 12, 2010. Owners may contact Daimler Trucks at 1-800-547-0712. Daimler Trucks' recall campaign number is 10C-6.

**10V-472**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Auto Outfitters on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Auto Outfitters by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-473**

Chrysler is recalling certain model year 2010 Dodge Ram D2, DJ, and DS-Body vehicles for failing to comply with the requirements of Part 567, "Certification." Some vehicles have been built with certification and/or supplemental tire pressure information labels printed with incorrect weight or seating capacity information. The misinformation on these labels could lead to, among other things, failure to follow proper vehicle loading specifications that could increase the risk of a crash. Owners will be provided with replacement certification and/or supplemental tire pressure information labels. At the customer's option, they may take their vehicle to a Chrysler dealer for installation. This service will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact Chrysler at 1-800-853-1403. Chrysler's campaign number is K27.

**10V-474**

Chrysler is recalling certain model year 2010 Chrysler Sebring, 300, Charger (LX) and Dodge Challenger (LC), Avenger (JS), and Journey (JC), as well as model year 2011 Dodge Ram light duty pickup (DS) vehicles. Some of these vehicles may experience a separation at the crimped end of the power steering pressure hose assembly. Leaked power steering fluid onto hot engine components could cause a fire. Dealers will inspect and replace as necessary the power steering pressure hoses free of charge. The safety recall is expected to begin during November 2010. Owners may contact Chrysler at 1-800-853-1403. Chrysler's recall campaign number is K26.

**10V-475**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Goldworks & Graphics on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Goldworks & Graphics by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-476**

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Truck & Auto Elegance on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Truck & Auto Elegance by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-477**

Keystone is recalling certain model year 2011 recreational vehicles equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Dealers will isolate and perform a drop pressure test on the oven supply tube and if the tube leaks it will be replaced free of charge. The safety recall began on October 27, 2010. Owner may contact Keystone customer service at 1-866-425-4369.

**10V-478**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Carolina Restyling on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Carolina Restyling by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-479**

GM is recalling certain model year 2009-2010 Chevrolet Impalas for failing to comply with the requirements of Federal Motor Vehicle Safety Standard No. 210, "Seat Belt Assembly Anchorages." The front safety belt webbing may not have been properly secured to the lap belt anchor pretensioner mounted to the side of the seat nearest the door. The safety belt may not restrain the occupant as intended during a crash, which could result in injury to the occupant. Dealers will inspect both front safety belts for proper

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

installation of the anchors to the pretensioners and, if necessary, reinstall the anchors. This service will be performed free of charge. The safety recall began on October 26, 2010. Owners may contact Chevrolet at 1-800-630-2438 or at the owner center at [www.gmownercenter.com](http://www.gmownercenter.com).

**10V-480**

Altec is recalling certain model year 2009-2010 Altec Digger Derricks built from April 2009 through May 2010. The turntable devices on these vehicles have used high strength fasteners that may fail due to stress corrosion and cracking. Failure of a fastener could cause the pedestal to separate from the turntable and may cause an occupant to fall from the vehicle and suffer injury. Dealers will replace the fasteners free of charge. The safety recall began on October 15, 2010. Owners may contact Altec at 1-877-462-5832.

**10V-481**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Coach Automotive Restyling on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Coach Automotive Restyling by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-482**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Skip's Sunroofs on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Skip's Sunroofs by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-483**

Carriage is recalling certain recreational vehicles equipped with Dimplex Electraflame, Symphony, or

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

Optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat. An overheated receiver could cause a fire. Carriage is working with Dimplex and Dimplex will provide owners a free replacement plug-in remote control kit. The recall is expected to begin during November 2010. Owners may contact Dimplex North America customer service at 1-888-346-7539.

**10V-484**

Altec is recalling certain model year 2008-2009 Digger Derricks utility vehicles built from September 2008 through May 2009. The digger bail pins installed on these vehicles were not properly heat treated and can develop cracks during auger use. The digger could become separated from the digger bail allowing the auger/digger assembly to swing freely from the digger hoses. A swinging auger/digger could strike a bystander causing serious injury or death. Dealers will replace the pins free of charge. The safety recall is expected to begin during November 2010. Owners may contact Altec at 1-877-462-5832.

**10V-485**

Daimler Trucks is recalling certain Thomas Built MVP-EF, HDX, and Saf-T-Liner C2 school buses manufactured from March 17, 2009, through December 7, 2009, equipped with Stabilus Bloc-O-Lift, p/n 5561ED, driver seats. The weld which holds the mounting tab to the shock body was improperly welded and can break. The seat could drop unexpectedly without prior warning and could cause momentary loss of steering control, possibly resulting in a crash. Daimler Trucks will notify owners and repairs will be performed by authorized Thomas Built Buses service facilities free of charge. The safety recall is expected to begin on or about December 10, 2010. Owners may contact Daimler trucks at 1-800-547-0712.

**10V-486**

Daimler Trucks is recalling certain Thomas Built MVP-EF and HDX non school buses manufactured from March 17, 2009, through December 7, 2009, equipped with Stabilus Bloc-O-Lift, p/n 5561ED, driver seats. The weld which holds the mounting tab to the shock body was improperly welded and can break. The seat could drop unexpectedly without prior warning and could cause momentary loss of steering control, possibly resulting in a crash. Daimler Trucks will notify owners and repairs will be performed by authorized Thomas Built Buses service facilities free of charge. The safety recall is expected to begin on or about December 10, 2010. Owners may contact Daimler trucks at 1-800-547-0712.

**10V-487**

BMW is recalling certain model year 2004-2010 motorcycles. The bearings could be subject to corrosion. This could lead to reduced movement of the link lever. This could affect the handling of the motorcycle increasing the risk a driver may lose control of the vehicle resulting in a crash. The manufacturer has not yet provided a remedy or an owner notification schedule for this campaign. Owners may contact BMW at 1-800-525-7417.

**10V-488**

Volvo is recalling certain model year 2010-2011 S80, XC70, model year 2011 XC60 and model year 2010 V70 vehicles. There may be an intermittent fault in the driver's airbag clockspring wiring connector

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

for the supplemental restraint system. In the event of a crash, the driver's frontal airbag may not deploy as intended or at all, and therefore will not be able to properly protect the driver, increasing the risk of injuries. Dealers will install a metal shim in the driver's air bag clockspring wiring connector. This service will be performed free of charge. The safety recall began on October 20, 2010. Owners may contact Volvo at 1-800-458-1552.

**10V-489**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Southside Trim on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Southside Trim by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-490**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Blue Sky on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Blue Sky by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-491**

Volvo is recalling certain model year 2008-2011 VHD, VNL, VNM, as well as 2008-2010 VT vehicles for failing to comply with the requirements of Part 567, "Certification." The tire description may be incorrect on the vehicle's certification label. The misinformation on these labels could lead to a vehicle overloading that can increase risk of a crash. Dealers will inspect and replace the labels free of charge. The safety recall is expected to begin on or before December 1, 2010. Owners may contact Volvo at 1-800-458-1552. Volvo safety recall no. RVXX1005.

**10V-492**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

Heartland is recalling certain model year 2011 North Country travel trailers manufactured from July 14, 2010, through September 14, 2010, equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Heartland is working with Atwood and will replace or repair the stoves free of charge. The safety recall began on October 22, 2010. Owners may contact Atwood at 1-574-266-4749 or Heartland at 1-877-262-8032. Heartland safety recall no. 99-01-05.

**10V-493**

Dutchmen is recalling certain model year 2011 Voltage fifth wheel travel trailers manufactured from August 13, 2010, through September 29, 2010, equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Dutchmen is working with Atwood and Atwood will replace or repair the stoves free of charge. The safety recall began on November 4, 2010. Owners may contact Atwood at 1-574-266-4749 or Dutchmen Warranty Service Department at 1-866-869-1109.

**10V-494**

Crossroads is recalling certain model year 2011 Zinger and Sunset Trail trailers manufactured from August 15, 2010, through September 29, 2010, equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Crossroads is working with Atwood and will replace or repair the stoves free of charge. All of the affected vehicles are contained at Crossroads' dealerships. Therefore, an owner notification letter will not be issued for this campaign. Owners may contact Atwood at 1-574-266-4749 or Crossroads at 1-888-226-7496.

**10V-495**

BMW is recalling certain 2007 through 2010 F 650 GS motorcycles manufactured from November 2006 through January 2010. A washer may interfere with the front disc brake fasteners' torque. As a result, over time, a fastener or multiple fasteners could become loose, allowing the brake disc to become loose. A loose brake disc may interfere with proper braking performance and may increase the risk of a crash. The manufacturer has not yet provided a remedy or an owner notification schedule for this campaign. Owners may contact BMW at 1-800-525-7417.

**10V-496**

Newmar is recalling certain model year 2011 bay star ca recreational vehicles manufactured from August 6, 2010, through October 5, 2010, equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Newmar is working with Atwood and Atwood will replace or repair the stoves free of charge. The manufacturer has not yet provided an owner

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

notification schedule. Owners may contact Atwood at 1-574-266-4749 or Newmar at 1-574-773-7791.

**10V-497**

Open Range is recalling certain model year 2011 Journeyer, Open Range, and Roamer recreational vehicles manufactured from July 1, 2010, through September 20, 2010, equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Open Range is working with Atwood and Atwood will replace or repair the stoves free of charge. The safety recall began on October 28, 2010. Owners may contact Atwood at 1-574-266-4749.

**10V-498**

Toyota is recalling certain model year 2005-2006 Avalon, model year 2004-2006 Highlander, model year 2004-2006 Lexus RX, and model year 2006 Lexus GS and IS vehicles. Brake fluid containing polymers is used that acts as lubricants for certain brake system components. If replacement brake fluid is used that does not contain such polymers, or that contains only small amounts, a part of the rubber seal located at the rear of the brake master cylinder may become dry, and the seal may curl during movement of the piston. If this occurs, a small amount of brake fluid could slowly leak from the seal into the brake booster. A leak of brake fluid could lead to a change in brake pedal feel and overtime a degradation in braking performance increasing the risk of a crash. Dealers will replace the seal with a newly designed one. This service will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact Toyota at 1-800-331-4331 and Lexus at 1-800-255-3987.

**10V-499**

Jayco is recalling certain model year 2011 travel trailers and fifth wheels manufactured from August 16, 2010, through October 1, 2010, equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Jayco is working with Atwood and Atwood will replace or repair the stoves free of charge. The safety recall is expected to begin during November 2010. Owners may contact Atwood at 1-574-266-4749 or Jayco at 1-574-825-0608.

**10V-500**

Great Dane is recalling certain MPA20, MPA38, and MPA40 trailers equipped with Arvin Meritor suspension systems. The suspect systems may have missing welds at the interface of the lower seat bracket and axle beam. Missing welds could allow the axle to roll out of position and potentially impact the handling of the trailer such that a driver may lose control of the vehicle, increasing the risk of a crash. Great Dane is working with Arvin Meritor to identify owners with the affect suspension systems. The affected vehicles will be repaired free of charge. The safety recall began on October 28, 2010. Owners may contact Great Dane at 1-912-644-2100 or Arvin Meritor at 1-248-435-0896.

**10V-501**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

Starcraft is recalling certain model year 2011 travel trailers and fifth wheel travel trailers manufactured from August 16, 2010, through October 1, 2010, equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Starcraft is working with Atwood and Atwood will replace or repair the stoves free of charge. The safety recall is expected to begin during November 2010. Owners may contact Atwood at 1-574-266-4749 or Starcraft at 1-800-945-4787.

**10V-502**

Open Range is recalling certain model year 2011 fifth wheel travel trailers and Toy Haulers manufactured from August 17, 2010, through September 9, 2010, and equipped with Dexter Axles. On some axles, cracks could appear in the spindle weld. These cracks can propagate and cause the spindle to detach from the axle tube, resulting in the separation of the wheel end from the vehicle, creating a road hazard that increases the risk of a crash to other vehicles, and compromises the driver's control of the vehicle increasing the risk of a vehicle crash. Open Range is working with Dexter Axle and will inspect the axle serial number and replace it if it falls within the serial number range. Replacement of the axle will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact Open Range at 1-260-768-7771 and Dexter Axle at 1-800-400-2164.

**10V-503**

Honda is recalling certain model year 2005-2007 Odyssey and Acura RL vehicles. Brake fluid containing polymers is used that acts as a lubricant for certain brake system components. If replacement brake fluid is used that does not contain such polymers, or that contains only small amounts, a part of the rubber seal located at the rear of the brake master cylinder may become dry, and the seal may curl during movement of the piston. If this occurs, a small amount of brake fluid could slowly leak from the seal into the brake booster. A leak of brake fluid could lead to a change in brake pedal feel and overtime a degradation in braking performance increasing the risk of a crash. Dealers will replace the brake master cylinder seal free of charge. The recall is expected to begin during December 2010. Owners may contact Honda at 1-800-999-1009.

**10V-504**

Crossroads is recalling certain recreational vehicles equipped with Dimplex Electraflame, Symphony, or Optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat. An overheated receiver could cause a fire. Crossroads is working with Dimplex and Dimplex will provide owners a free replacement plug-in remote control kit. The safety recall is expected to begin during November 2010. Owners may contact Dimplex North America customer service at 1-888-346-7539 or Crossroads at 1-888-226-7496.

**10V-505**

Hyundai Translead is recalling certain model year 2011 53 foot composite dry van trailers, equipped with AvinMeritor suspension systems. The suspect systems may have missing welds at the interface of the lower seat bracket and axle beam. Missing welds could allow the axle to roll out of position and

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

potentially impact the handling of the trailer such that a driver may lose control of the vehicle, increasing the risk of a crash.

Hyundai Translead is working with ArvinMeritor to identify owners with the affect suspension systems. The affected vehicles will be repaired free of charge. The safety recall began on October 27, 2010. Owners may contact Hyundai Translead at 1-619-680-3144 or ArvinMeritor at 1-248-435-0896.

**10V-506**

Kawasaki is recalling certain model year 2009-2010 Vulcan motorcycles. The engine may stall if the rider is coasting with the clutch pulled in due to an improper setting of the engine control unit (ECU). Engine stalling could create a potential for a crash resulting in injury or death. Dealers will replace the ECU with one containing revised settings to address the engine stalling. The safety recall began on November 1, 2010. Owners may contact Kawasaki consumer services department at 1-866-802-9381.

**10V-507**

Coachmen is recalling certain model year 2011 Chaparral, Brookstone, and Northridge fifth wheel travel trailers equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Coachmen is working with Atwood and Atwood will replace or repair the stoves free of charge. The safety recall is expected to begin during October or early November 2010. Owners may contact Atwood at 1-574-266-4749 or Coachmen at 1-574-825-8360.

**10V-508**

Eclipse Recreational Vehicles, Inc. is recalling certain model year 2011 Attitude, Milan, Stellar RVs equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Eclipse is working with Atwood and Atwood will replace or repair the stoves free of charge. The safety recall is expected to begin during November 2010. Owners may contact Atwood at 1-574-266-4749 or Eclipse at 1-951-684-6868.

**10V-509**

Evergreen is recalling certain model year 2011 RVs manufactured from July 1, 2010, through September 30, 2010, and equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Evergreen is working with Atwood and Atwood will replace or repair the stoves free of charge. The safety recall began on October 28, 2010. Owners may contact Atwood at 1-574-266-4749 or Evergreen at 1-574-825-4298.

**10V-510**

Medtec is recalling certain model year 2007 through 2010 ambulances manufactured from September 14, 2007, through April 15, 2010. The rear facing ambulance attendant seat was not equipped with a type 2 seat belt assembly, and so the vehicles fail to conform to the requirements of Federal Motor Vehicle

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

Safety Standard No. 208, "Occupant Crash Protection." Use of an improper seat belt assembly may increase the risk of injury to the seat occupant in the event of a crash. Medtec will notify owners and dealers will install a type 2 seat belt assembly free of charge. The safety recall is expected to begin during November 2010. Owners may contact Medtec toll-free at 1-866-263-3832.

**10V-511**

Tiffin Motorhomes is recalling certain model year 2011 Allegro, Allegro Bus, and Phaeton RVs equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Tiffin is working with Atwood and will replace or repair the stoves free of charge. The safety recall began on October 28, 2010. Owners may contact Atwood at 1-574-266-4749 or Tiffin 1-256-356-8661.

**10V-512**

Suzuki is recalling certain model year 2007 SX4 hatchback and model year 2008-2010 SX4 hatchback and sedan passenger vehicles. The three screws that secure each of the outside rear view mirrors to the mirror base can come loose due to vibration. If a rear view mirror falls off the vehicle the driver will have reduced visibility increasing the risk of a crash. Dealers will replace the base screws on both outer rear view mirrors free of charge. The safety recall began on November 5, 2010. Owners may contact Suzuki at 1-887-697-8985 or visit Suzuki's website at <http://www.suzukiauto.com>.

**10V-513**

Mitsubishi is recalling certain model year 2006-2008 Endeavor with manual air conditioning. Due to an incorrect heater (HVAC) controller signal, the air flow from the air vents may randomly change direction and/or the temperature may briefly cycle between hot and cold. This condition could affect defroster performance, resulting in poor windshield visibility and potentially cause a crash. Dealers will inspect for damage and if necessary repair the mode door shaft free of charge. The safety recall is expected to begin during December 2010. Owners may contact Mitsubishi at 1-800-222-0037.

**10V-514**

Timpte is recalling certain model year 2009-2011 TDH trailers equipped with aluminum upper couplers. These trailers have the potential to fracture some of the structural components of the upper coupler. This could cause premature failure of the upper coupler increasing the risk of personal injury to the driver. Dealers will install updated reinforcement brackets to the main beam and front support channels to prevent possible failures. This service will be performed free of charge. The safety recall began on November 5, 2010. Owners may contact Timpte at 1-402-367-3056.

**10V-515**

Ford is recalling certain model year 2011 Edge and Lincoln MKX vehicles manufactured from July 1, 2010, through October 8, 2010. These vehicles were shipped with incorrectly configured electronic

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

module settings that disable the locking function of the liftgate. Accordingly, the vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 206, "Door Locks and Door Retention Components." The liftgate lock may be disabled and the driver may not be able to lock the liftgate using interior lock switches or remote key fob buttons. Ford will notify owners and dealers will have the affected control modules updated free of charge. The safety recall began on November 1, 2010. Owners may contact Ford at 1-866-436-7332.

**10V-516**

Nissan is recalling certain model year 2004-2006 Armada, Titan, Infiniti QX56 and model year 2005-2006 Frontier, Pathfinder and Xterra Vehicles. The intelligent power distribution module (IPDM) assembly contains an engine control module (ECM) relay that has a diode for electrical current noise reduction. The ECM relay may allow silicon vapor to form and, over time, the silicon evaporates from the diode molding which causes silicon oxide to develop on the ECM relay contact due to arcing. This could cause engine stalling increasing the risk of a crash. Dealers will replace the ECM relay inside the IPDM assembly. This service will be performed free of charge. The safety recall is expected to begin during December 2010. Owners may contact Nissan at 1-800-647-7261.

**10V-517**

BMW is recalling certain model year 2008 X5 SAVs vehicles with 6-cylinder engines manufactured from November 1, 2007 through August 31, 2008. Due to a manufacturing process fault, the fuel pump was not produced to specifications. Under specific vehicle operating conditions, the fuel pump's commutator could experience an increase in wear. This wear could lead to fuel pump malfunction and engine stalling. Engine stalling could create a potential for a crash resulting in injury or death. The manufacturer has not yet provided a remedy or an owner notification schedule for this campaign. Owners may contact BMW at 1-800-525-7417.

**10V-518**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by San Francisco Maz on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by San Francisco Maz by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-519**

Sunnybrook is recalling certain recreational vehicles, manufactured from October 2002 through May 2008, equipped with Dimplex Electraflame, Symphony, or Optiflame branded electric fireplaces, stoves,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

and fireplace inserts. The plug in remote control receiver for the fireplace can overheat. An overheated receiver could cause a fire. Sunnybrook is working with Dimplex and Dimplex will provide owners a free replacement plug-in remote control kit. The safety recall is expected to begin during November 2010. Owners may contact Dimplex North America customer service at 1-888-346-7539.

**10V-520**

Keystone is recalling certain recreational vehicles equipped with Dimplex Electraflame, Symphony, or Optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat. An overheated receiver could cause a fire. Keystone is working with Dimplex and Dimplex will provide owners a free replacement plug-in remote control kit. The recall is expected to begin during November 2010. Owners may contact Dimplex North America customer service at 1-888-346-7539.

**10V-521**

SunnyBrook is recalling certain recreational vehicles equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. SunnyBrook is working with Atwood and Atwood will replace or repair the stoves free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Atwood at 1-574-266-4749 or SunnyBrook at 1-574-825-5250.

**10V-522**

TMC is recalling certain model year 2011 Damon Daybreak, Four Winds Freedom Elite, and Hurricane recreational vehicles equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. TMC is working with Atwood and will replace or repair the stoves free of charge. The safety recall began on November 8, 2010. Owners may contact Atwood at 1-574-266-4749 or TMC warranty/service department at 1-877-855-2867.

**10V-523**

Open Range is recalling certain model year 2009-2011 Open Range, Residential and Rolling Thunder recreational vehicles equipped with 1200-series Norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. An insufficient response time can result in power not being shut-off in sufficient time to prevent a fire, which has the potential to ignite resulting in personal injury and/or vehicle and property damage. Open range is working with Norcold to get the units repaired free of charge. Please see Norcold's defect report 10E-049. The recall began on October 30, 2010. Owners may contact Norcold at 1-800-767-9101.

**10V-524**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

Hollandia TVS 900 series sunroofs installed as original equipment by Prestige Auto Specialties on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Prestige Auto Specialties by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-526**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Auto Trim Design & Glass on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Auto Trim Design & Glass by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-527**

Webasto Product North America, Inc. (Webasto) is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs installed as original equipment by Auto Trim Restyling on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash. Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from Webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Auto Trim Restyling by clicking on the hyperlink affected vehicle list or you may visit Webasto's website at <http://www.sunroofcheck>. You can also call Webasto toll-free at 1-888-749-8632.

**10V-528**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

Eldorado National is recalling certain model year 2007-2008 Aerotech motor homes equipped with Trans Air TA 73 evaporators. The evaporator utilizes a power resistor to regulate blower speed. Should a short occur in the "low or medium speed" circuit while the blower is in high speed, the short will cause the supply voltage to feedback through the resistor to ground, not drawing enough current to trip the fuse. This would cause the resistor temperature to rise to a point where it will melt and possibly ignite the plastic blower housing to which it is mounted. The overheating can result in a fire. Eldorado in cooperation with Trans Air will install a thermal shutdown device in series with the speed resistors. This service will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact Trans Air warranty and service center at 1-800-673-2446.

**10V-532**

Goshen Coach is recalling certain model year 2006-2007 Goshen GC II motor homes equipped with Trans Air TA 73 evaporators. The evaporator utilizes a power resistor to regulate blower speed. Should a short occur in the "low or medium speed" circuit while the blower is in high speed, the short will cause the supply voltage to feedback through the resistor to ground, not drawing enough current to trip the fuse. This would cause the resistor temperature to rise to a point where it will melt and possibly ignite the plastic blower housing to which it is mounted. The overheating can result in a fire. Goshen Coach in cooperation with Trans Air will install a thermal shutdown device in series with the speed resistors. This service will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact Trans Air warranty and service center at 1-800-673-2446.

**10V-534**

Paccar is recalling certain model year Kenworth T660, T700, T800 and W900 vehicles manufactured from December 22, 2010, through August 2, 2010, and equipped with AG400L air disc brakes. The air disc brake caliper could be installed on the wrong side of the drive axle potentially causing interference with the suspension bracket and the rear suspension as the outermost brake pads wear and the floating caliper moves inboard. As this interference gets larger, this could eventually lead to reduced braking performance, increasing the risk of a crash. Dealers will verify the correct orientation of the brake caliper and perform the necessary repair free of charge. The safety recall is expected to begin during November 2010. Owners may contact Kenworth at 1-425-828-5440.

**10V-535**

Mack Trucks is recalling certain model year 2010 through 2011 CXU, heavy trucks manufactured from August 12, 2009, through August 31, 2010. The rear hold-down brackets that secure the battery box lid may be rotated too far forward, which may restrict the battery box lid from properly seating. If this occurs, the battery box lid may come off when stepping on the step, which may cause a person to fall from the vehicle resulting in personal injury. Mack will inspect and adjust the rear hold-down brackets as required free of charge. The safety recall is expected to begin on or before December 1, 2010. Owners may contact Mack Trucks at 1-800-866-1177.

**10V-536**

Mack Trucks is recalling certain model year 2011 CHU and CXU, heavy trucks manufactured from July 13, 2010, through August 13, 2010, without rear mud flap hanger brackets. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 108, "Lamps, Reflective Devices,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2010**

*Published November 9, 2010*

and Associated Equipment." The rear conspicuity treatment typically found on the mud flap hanger brackets may not have been installed in the alternate positions as allowed in the regulation on vehicles manufactured without rear mud flap hanger brackets. Lack of reflectors could lead to reduced visibility of the vehicle increasing the risk of a crash. Dealers will inspect and install conspicuity treatment as required free of charge. The safety recall is expected to begin on or before December 1, 2010. Owners may contact Mack Trucks at 1-800-866-1177.

**10V-537**

Fleetwood is recalling certain Class-A and Class-C motor homes equipped with Atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury. Fleetwood is working with Atwood and will replace or repair the stoves free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Atwood at 1-574-266-4749.

**10V-539**

Mercedes Benz is recalling certain model year 2011 M- Class, model W164, GL-Class, model X164, E-Class, model W212, R-Class, and model V251 vehicles. The O-ring may not have been properly lubricated in all cases. Lack of lubrication can lead to leakage of the fuel filter. Diesel fuel may be deposited on roads and making those roads slippery, increasing the potential for a crash. Dealers will replace the fuel filters free of charge. The safety recall is expected to begin during November 2010. Owners may contact Mercedes Benz at 1-800-367-6372.

**10V-540**

Miller Electric is recalling certain trailers for improper hub assembly installation. During the assembly supplier's manufacturing, the assembly bearings may not have been properly torque. An improperly torqued bearing could cause the bearing to fail, resulting in a failure of the wheel assembly and a risk of a wheel falling off, during vehicle operation, increasing the risk of a crash. Miller electric will inspect and replace the hub assembly and properly re-install the hub assembly free of charge. The safety recall is expected to begin during November 2010. Owners may contact Miller Electric at 1-920-734-9821.

**10V-541**